

### SERVICE INSTRUCTION


**Number:** 381-1933

**Year:** 1998

**Month:** MARCH

**Market:** ALL

### SID message "TIME FOR SERVICE"

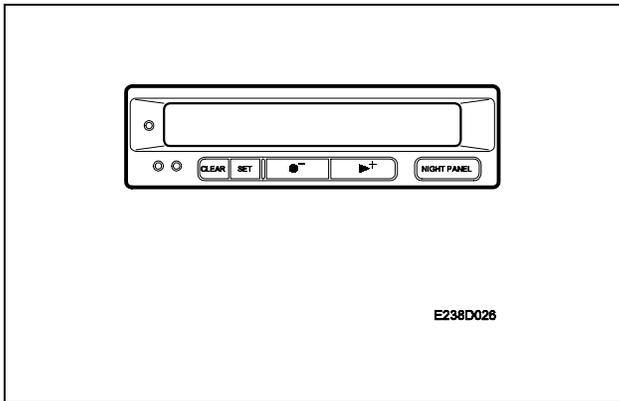

### Cars affected

All Saab 9-5

### Background

The new software in the SID requires a different procedure to cancel the "TIME FOR SERVICE" message with the CLEAR button on the SID.

Note that the normal procedure using Tech 2 still applies.

### Procedure

To reset the "TIME FOR SERVICE" message on the SID (without using Tech 2), the following procedure must be followed:

- 1 Press the CLEAR button once.
- 2 Press the CLEAR button a second time and hold it pressed in for at least 8 seconds.  
The SID will give two acoustic signals one shortly after the other. On the second signal the message "SERVICE" will start to flash.
- 3 Start the engine to make sure that the message has been cancelled.